
 |d|i|g|i|t|a|l|
 |_|_|_|_|_|_|_|_|

FCO LN03S-I001

Level of
 Urgency
 [I]

Page 1
 Of 4

FIELD CHANGE ORDER

Number: LN03S-I001

Applicability: This FCO is for the LN03S-XX printer when used in the VAXmate configuration. This FCO implements ECO # 5416943-ML002.

1. Remove ROMs from E26 and E29 on the plus controller module.
2. Replace E26 and E29 as follows.
 - E26 23-207E6-0-0
 - E29 23-208E6-0-0

Problem/Symptoms: When the LN03X-IC cartridge (ISO/PC) is installed in the LN03S printer, the cartridge appears to be inoperative.

Quick Check: Press the test button and read the summary sheet. The plus revision level should read V1.1 or higher.

Compatibility/Prerequisite FCO: N/A

Est. Time to Install
 1.0 hour

Special Tools or Test Equipment: N/A

FCO Parts Information

Order by FCO Kit #	Contents		
	Quantity	Part Number	Description
EQ-01446-01	1	23-207E6-00	ROM
	1	23-208E6-00	ROM
FA-04732-01	1		FCO Document

EQ Kit Variation/System-Option Applic: N/A

Approvals

CSSE Engineer C. Lanteigne	F.S. Product Safety Larry Kershaw	F.S. Logistics Ed Duggan
Responsible CSSE Mgr Ed McHugh	F.S. Microfiche Libraries EP-FSNVX-LB VAX	Affected Population 200
Micromedia Publishing Ray LeBlanc	EP-FSLCG-LB LCG EP-FSP11-LB PDP11 EP-FSPD8-LB PDP8	Initial Kitting 200
Revision A	VAXnotes	Hardcopy Publication 300

FCO Release Date	STARS	Parts Availability
7-OCT-86		October 1986

EN-01095-12-REVB(548)

```

- - - - -
|d|i|g|i|t|a|l|
- - - - -

```

FCO LN03S-I001

PAGE 2 OF 4

REWORK PROCEDURE
For plus Controller Module 54-16943-01

This Rework Procedure allows the LN03S-XX to fully utilize the LN03X-IC cartridge (ISO/PC) for use in the VAXmate configuration.

Use the LN03 Pocket Service Guide, EK-0LN03-PC-002 and perform the following:

```

*****
*                               *
*           NOTE                 *
*   Before removing any parts be sure that all *
*   power is removed from the printer.         *
*****

```

1. Remove rear cover.
2. Remove Plus Controller Module.

```

*****
*                               *
*           CAUTION              *
*   Use proper ESD protection to protect module *
*   from static discharge.         *
*****

```

3. Refer to attachment (Figure 1) for correct locations of ROMs to be removed and replaced.
4. Remove ROM in location E26 and replace it with new ROM 23-207E6-0-0.
5. Remove ROM in location E29 and replace it with new ROM 23-208E6-0-0.

```

*****
*                               *
*           NOTE                 *
*   Check installed ROMs and insure that they are *
*   seated correctly and that there are no bent *
*   pins.                               *
*****

```

6. Reinstall Plus Module and cover by reversing steps above.
7. Perform LN03 self test in accordance with the Pocket Service Guide. The self test sheet should now indicate a plus revision level of V1.1.
8. When all tests have been passed the installation is complete.
9. Update The Site Management Guide to reflect this FCO.
10. Report LARS activity as per example, page 4 of this FCO.

```

- - - - -
| | | | |
| d | i | g | i | t | a | l |
| - | - | - | - | - | - | - |

```

FCO LN03S-I001

PAGE 3 OF 4

Figure 1

```

- - - - -
| | | | |
| d | i | g | i | t | a | l |
| - | - | - | - | - | - | - |

```

FCO LN03S-I001

PAGE 4 OF 4

LARS

Activity	DEC Option	Type of Call	Action Taken	FCO # Comments	Material Used
----------	---------------	--------------------	-----------------	-------------------	------------------

For Contract and Warranty Customers U.S. and G.I.A.

W	LN03	M	D	LN03S-I001	EQ-01446-01
---	------	---	---	------------	-------------

For Per CALL Customers U.S., G.I.A and Europe

F	LN03	M	D	LN03S-I001	EQ-01446-01
---	------	---	---	------------	-------------

For Contract and Warranty Customers Europe

Y LN03 M D LN03S-I001 EQ-01446-01

\^ LN03S
\LN03S
\LANTEIGNE
\1986
\OCT
\FCO_DOCS