DIGITAI				FCC	)					EGOR	Y	PAGE OF	1 3
FIELD CHANGE ORDER						NUMBER: RA9X-0006							
APPLICA	ABILIT	Υ:											
		_			plies, H7 ee page 2						the ve	ndor C	EAG
PROBLEM RA9x di tempera	rives v	will po		f v	within a	perma	nent fa	als	se pow	er s	upply o	ver	
SOLUTION Replace		power :	supply	wit	th an alt	ternat	ive or	re	eworke	d ve	rsion i	n EQ k	it.
QUICK (		CEAG 1	power s	upr	plies at	revis	ion lev	/el	L "N"	and	below.		
PRE/CO-REQUISITE FCO: Where possible also install FCO RA9X-F005 on the same visit						isit		MTTI   0.3	HRS				
TOOL/TI	EST EQU	JIPMEN'	[: 		N/A								
					FCO PAR	RTS IN	FORMATI	ION	1				
FCO KIT NO. DES			DES	ESCRIPTION OF CONTENTS						EQ KIT VARIATION APPLICABILITY			
~			23506-01 POWER SUPPLY 04968-01 FA DOCUMENT						     N/A				
		_ I		I	FCO CHARG	GING I	NFORMAT	ΓIC	ON	I			
WARR	ANTY/C	ONTRAC'	 [	<u> </u>		NONW	ARRANT'	Y/N	NONCON'	TRAC	 T		
ON-SI	ON-SITE		OFF-SITE		    ON-SITE		OFF-SITE		MATERIAL ONLY		Y		
TRAVEL/ INSTALL	EQ KIT	     INSTAI	EQ	   	  TRAVEL/   INSTALL	EQ KIT	    INSTAI	     L	EQ KIT		ORDER-ADMIN, HANDLI PKG, SHIPPING & EQ		
DEC	DEC	   DEC 	   DEC 		   CUS   	CUS	CUS	   	CUS	   	CU	S	
	I ———	I ————			APPF	ROVALS		—— I	I ———				
SPE   Keith Roper			DSHQ LOGISTICS Gerard Mulder				DS PRODUCT SAFETY Robert Brister						
SPE MANAGER Wico Meerwaldt			This document is published on multiple media including				FCO RELEASE DATE   August 1992						
MICROMEDIA Kim Marrama			Customer Services and MDS  Microfiche Libraries.  It also is available				   FCO REVISION   A						

	electronically via ITMA and	
POPULATION	the SSD CD-ROM.	PARTS AVAILABILITY
12,000		August 1992

++	FCO RA9X-0006
d   i   g   i   t   a   l	
	PAGE 2 OF 3
T	

## FCO APPLICABILITY

The affected power supplies from the vendor CEAG can be identified without removal, by checking their serial number and revision.

Affected power supplies have serial numbers with a plant code of "CG", for example CG03912345 AND a revision of "N" or below. Power supplies from the vendor Zenith have serial numbers with a plant code of "CX" and are NOT affected regardless of revision level. Affected power supplies were predominantly\* shipped in the following range of drive and cabinet options:

RA90	From	KB00008570	to	KB00024239
RA92			below	KB00005716
SA600	From	KB94201536		
SA650			below	KB11500857
SA800			below	KB11500814

\* A percentage of affected power supplies will fall outside of these ranges of options due to usage as spare parts, add-on and reconfiguration activity and a low volume used by CXO Manufacturing.

## FCO REWORK INSTRUCTIONS

- 1. Insure the customer has released the disk drive, take it offline and power it off.
- 2. Replace affected power supplies as per instructions in the RA90/RA92 Disk Drive Service Manual (EK-ORA90-SV), section 6.12 page 6-22.

CAUTION: Please check the line voltage selector switch on the power supply is correctly set before applying power.

3. If required, also install FCO RA9X-F005, microcode version 27 update before returning the disk drive to normal operation.

FCO RA9X-0006

PAGE 3 OF 3

## LARS EXAMPLE

CATEGORY O	USA	GIA	EUROPE
Activity -			
(a) Contract and Warranty	M	U	Y
(b) IN-DEC Contract	K	K	K
Hardware Segment Code	111	111	111
Non Contract/Non Warranty	F	F	F
(c) RTD/Off-site Agreement	F		
Product Line	031	031	031
DEC Option	RA9X	RA9X	RA9X
Type of Call	M	M	M
Action Taken	D	D	I
Fail Area-Module-FCO-Comments	RA9X-0006	RA9X-0006	RA9X-0006
Material Used	EQ-01633-01	EQ-01633-01	EQ-01633-01

- (a) Warranty Optimum, Warranty Standard and Warranty Basic (on site)
  Agreements
- (b) Applies to IN-DEC only Warranty Optimum, Warranty Standard and Warranty Basic (on-site) Agreements.
- (c) RTD=Return to Digital or Off-site Agreements; If Field Engineer On-site, use Activity Code "I".

\\FCO\_DOCS

\\RA9X \\RA90

/ /10212

\\RA92