



FCO Release Date  
10-JUL-87

Parts Availability:  
July 1987

-----  
|d|i|g|i|t|a|l|  
|\_|\_|\_|\_|\_|\_|\_|\_|

FCO 85XBA-R006

PAGE 2 OF 4

Applicability and Problem/Symptom cont. from page 1  
-----

This FCO contains the following ECOs:

BT-ZMAAD-C3-LK002 - (New part rev V22E)

1. Remote Port fix to correct loss of characters and "Disable Local Console" command.
2. The commands I, U, and START cannot be initiated unless the machine is halted.
3. The entire word TEST must be typed to invoke micro diagnostics.
4. System may crash when the PRO is powered off. This fix needs Console Rev "22E" and VMS V4.6.
5. The NBIB may log a "Read Retry Timeout" error when two other devices capable of Interlock instructions are on the same BI. This problem is fixed with a change to the CPU microcode.

EQ KIT - N/A  
-----

Rev "22E" and the Read Retry Microcode will NOT be available via EQ Kits. If needed, additional copies of Console Rev "22E" can be ordered from SDC (part number is ZM920).

FIELD INSTALLATION AND TEST PROCEDURE FOR FCO 85XBA-R006  
-----

1. Shut down the system by executing the Shutdown Command Procedure.

\$ @SYSS\$SYSTEM:SHUTDOWN

After VMS shuts down, type CTRL^P HALT.... you will now be in



Activity -			
Contract and Warranty	W or	U	Y
Non Contract/Non Warranty	F	U	F
DEC Option	85XBA	85XBA	85XBA
Type of Call	M	M	M
Action Taken	D	D	I
Fail Area-Module-FCO-Comments	85XBA-R006	85XBA-R006	85XBA-R006
Material Used	N/A	N/A	N/A

```

|_|_|_|_|_|_|_|_|_|
|d|i|g|i|t|a|l|
|_|_|_|_|_|_|_|_|_|

```

FCO 85XBA-R006

PAGE 4 OF 4

FCO History Chart

85XBA	B1	C1	D1	E1
----	--	--	--	--
FCO 85XBA-R001 F1001 Rev F		FCO 85XBA-I002 F1010 Rev B F1005 Rev B	FCO 85XBA-I003 H7176 Rev C2	FCO 85XBA-R006 Console V22E (5)
			FCO 85XBA-I004 H7061 REV B1	
			FCO 85XBA-R005 (Temp Sensor)	

```

\^ 85XBA
\\85XBA
\\POWERS
\\1987
\\JUL
\\FCO_DOCS

```